



Automotive & Powersports THE FACTS ABOUT YOUR INTAKE & AIR

ISO 5011 Tested to Make Sure You Maximize Airflow While Still Protecting Your Engine.

Part Number: 75-5075, 75-5075D
Description: Performance Intake Kit & Filter
Vehicle Applications: 2015-2016 Chevy / GMC Duramax 6.6L

Test Date: 01/06/17
Test Report #: 1, 2, 3, 4, 7

TECHNICAL BULLETIN

There is a lot of misinformation in the marketplace. S&B publishes specific test results for each of our intakes & filters as shown below, so you can make an informed decision. Remember, improving your airflow is only good if your engine is still protected. That's the S&B difference!

FACT: S&B Flows 29.10% Better than Stock

In tests performed in our climate controlled laboratory according to the ISO5011 Test Standard, S&B's intake kit (and filter) had significantly lower restriction (better airflow) than the stock intake system. See the graph on the next page.

WATCH OUT: Some competitors over state airflow.

If they state that their filter will flow, lets say 1000 cfm, without stating at what restriction level, they are trying to mislead you.

Description	% S&B Flowed Better than Stock (tested @ 612 cfm)
S&B Intake w/ Cleanable Filter (Secondary Inlet - Open)	29.10%
S&B Intake w/ Cleanable Filter (Secondary Inlet - Closed)	23.30%
S&B Intake w/ Dry Filter (Secondary Inlet - Open)	28.09%
S&B Intake w/ Dry Filter (Secondary Inlet - Closed)	20.35%

TEST CONDITIONS

Barometric Pressure	28.98
Airflow Setpoint	612 cfm
Relative Humidity	50
Temperature	70.2F
Type of Dust	ISO Coarse
Batch #	13099C
Dust Feed Rate (grams/minute)	17.33

FACT: S&B Protects Your Engine

S&B tests at the highest rated CFM for your vehicle when determining the efficiency rate (amount of dust the filter stops), so that we can be sure that your engine will be protected.


Description	Efficiency Rate (tested @ 612 cfm)
Stock	99.70%
S&B Intake w/ Cleanable Filter	99.45%
S&B Intake w/ Dry Filter	99.64%

WATCH OUT: Some Competitors Use the Same Efficiency Rates for Multiple Part Numbers.

Many send one filter off to a lab to be tested at a low cfm and then publish this efficiency rate for all of their part numbers.



**Air Flow vs Restriction
(lower restriction = better airflow)**

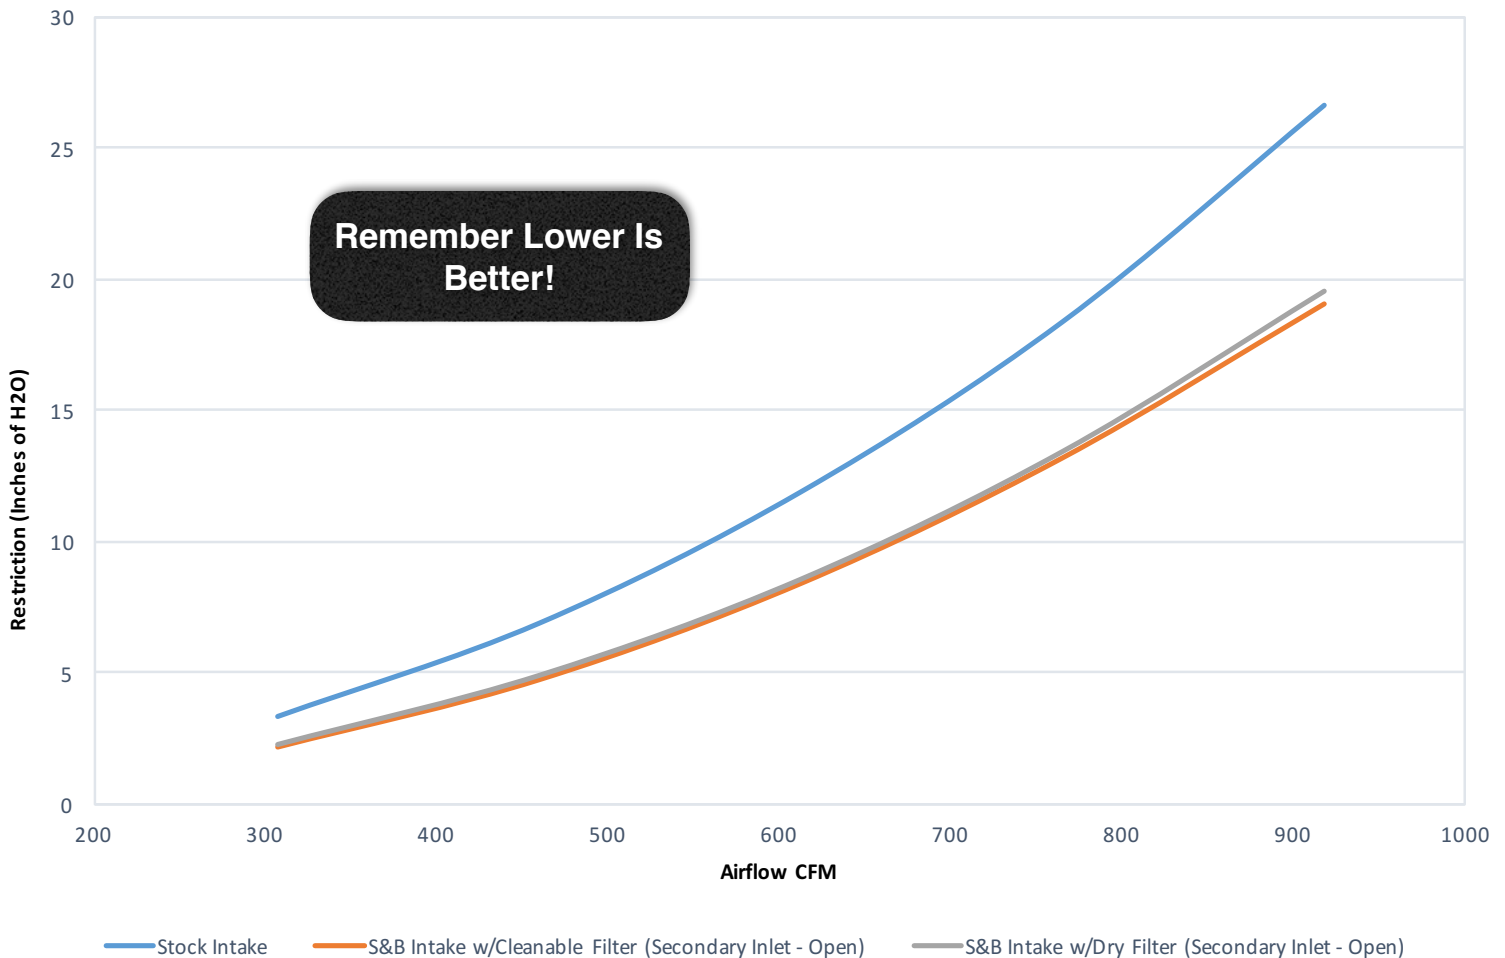

Air Filter Restriction Test Report

Test #: 406
Sample #: 7
Filter #: 25945274
Housing #:
Date Code:

Operator: SD
Report Date: 1/6/2017
Filter Mfg.:
Housing Mfg.:




Test Description: STOCK INTAKE AND FILTER, NO SENSORS, 25945274

Test Conditions

Barometric Pressure: 28.9428 in. Hg
Air Flow Type: SCFM
Number of Pleats:
Flow Direction:

Relative Humidity: 51 %
Temperature: 65 deg. F
Pleat Depth: in.

Air Flow Curve

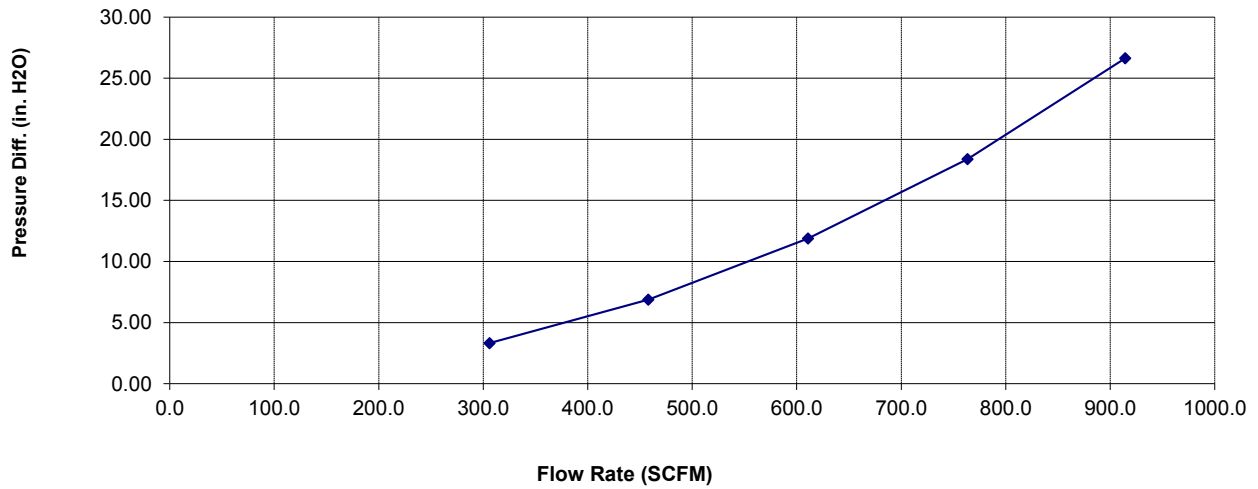

Air Flow Curve Data

<u>Flow Rate</u>	<u>Differential Pressure</u>
306	3.32
458	6.88
611	11.89
764	18.38
914	26.64

Air Filter Restriction Test Report

Test #: 406
Sample #: 1
Filter #: KF-1062
Housing #: 75-5075
Date Code:

Operator: SD
Report Date: 1/6/2017
Filter Mfg.:
Housing Mfg.:




Test Description: 75-5075 PRODUCTION KIT, NO SENSORS, PLUG INSTALLED, LID INSTALLED, KF-1062

Test Conditions

Barometric Pressure: 28.67752 in. Hg
Air Flow Type: SCFM
Number of Pleats:
Flow Direction:

Relative Humidity: 47 %
Temperature: 68 deg. F
Pleat Depth: in.

Air Flow Curve

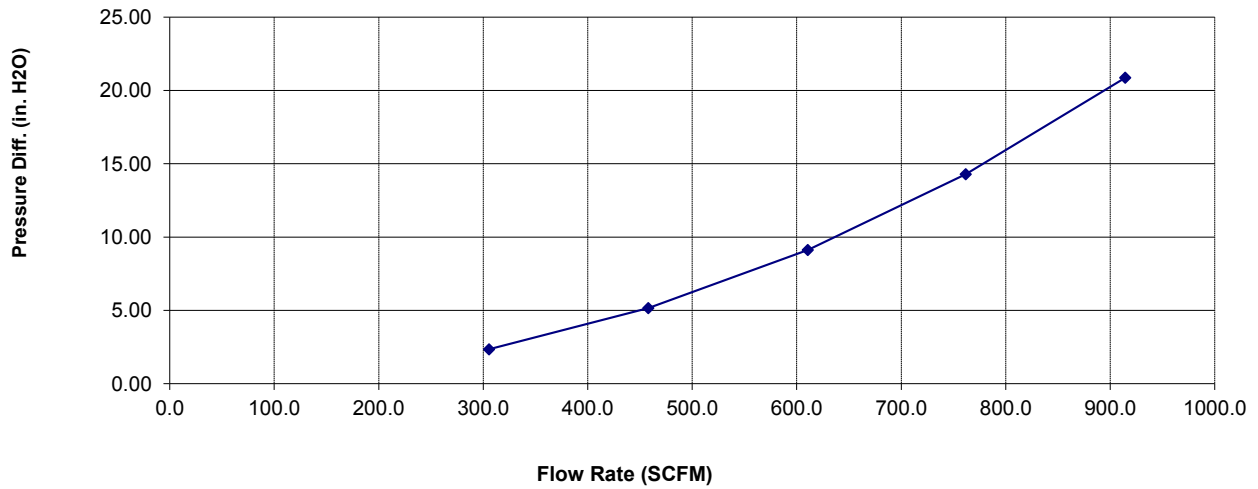

Air Flow Curve Data

<u>Flow Rate</u>	<u>Differential Pressure</u>
306	2.35
458	5.16
611	9.12
762	14.28
915	20.87

Air Filter Restriction Test Report

Test #: 406
Sample #: 2
Filter #: KF-1062
Housing #: 75-5075
Date Code:

Operator: SD
Report Date: 1/6/2017
Filter Mfg.:
Housing Mfg.:




Test Description: 75-5075 PRODUCTION KIT, NO SENSORS, PLUG REMOVED, LID INSTALLED, KF-1062

Test Conditions

Barometric Pressure: 28.68246 in. Hg
Air Flow Type: SCFM
Number of Pleats:
Flow Direction:

Relative Humidity: 46 %
Temperature: 68 deg. F
Pleat Depth: in.

Air Flow Curve

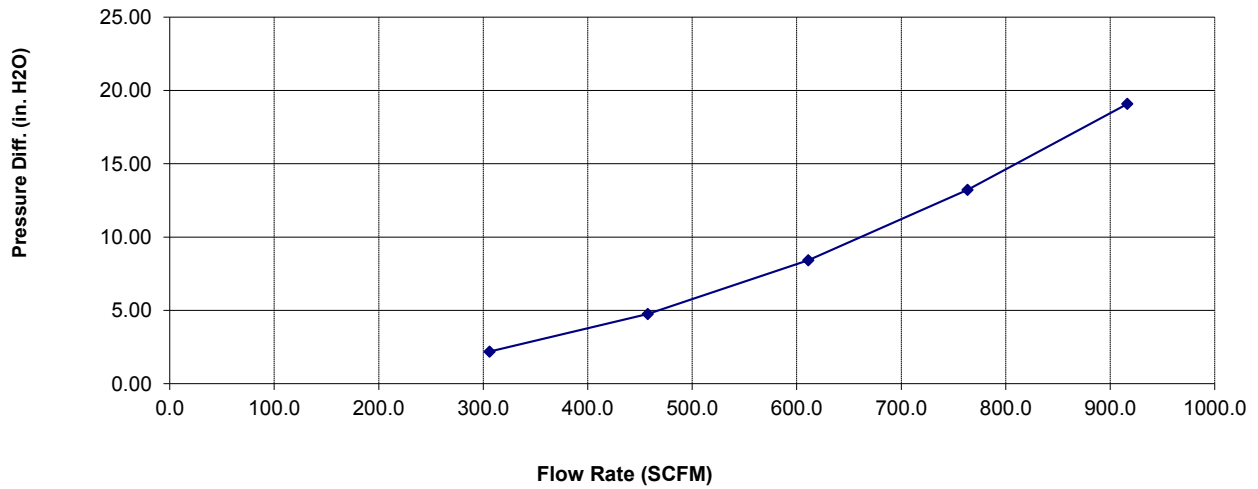

Air Flow Curve Data

<u>Flow Rate</u>	<u>Differential Pressure</u>
306	2.19
457	4.76
611	8.43
763	13.22
917	19.09

Air Filter Restriction Test Report

Test #: 406
Sample #: 3
Filter #: KF-1062D
Housing #: 75-5075
Date Code:

Operator: SD
Report Date: 1/6/2017
Filter Mfg.:
Housing Mfg.:




Test Description: 75-5075 PRODUCTION KIT, NO SENSORS, PLUG REMOVED, LID INSTALLED, KF-1062D

Test Conditions

Barometric Pressure: 29.11942 in. Hg
Air Flow Type: SCFM
Number of Pleats:
Flow Direction:

Relative Humidity: 51 %
Temperature: 69 deg. F
Pleat Depth: in.

Air Flow Curve

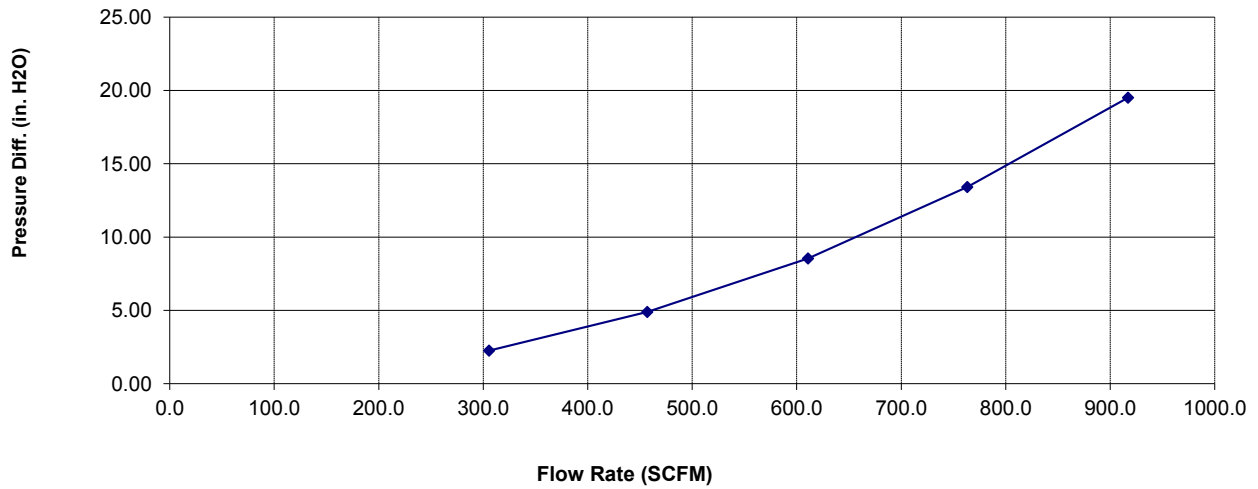

Air Flow Curve Data

<u>Flow Rate</u>	<u>Differential Pressure</u>
306	2.26
457	4.89
611	8.55
763	13.41
917	19.51

Air Filter Restriction Test Report

Test #: 406
Sample #: 4
Filter #: KF-1062D
Housing #: 75-5075
Date Code:

Operator: SD
Report Date: 1/6/2017
Filter Mfg.:
Housing Mfg.:




Test Description: 75-5075 PRODUCTION KIT, NO SENSORS, PLUG INSTALLED, LID INSTALLED, KF-1062D

Test Conditions

Barometric Pressure: 29.1237 in. Hg
Air Flow Type: SCFM
Number of Pleats:
Flow Direction:

Relative Humidity: 51 %
Temperature: 69 deg. F
Pleat Depth: in.

Air Flow Curve

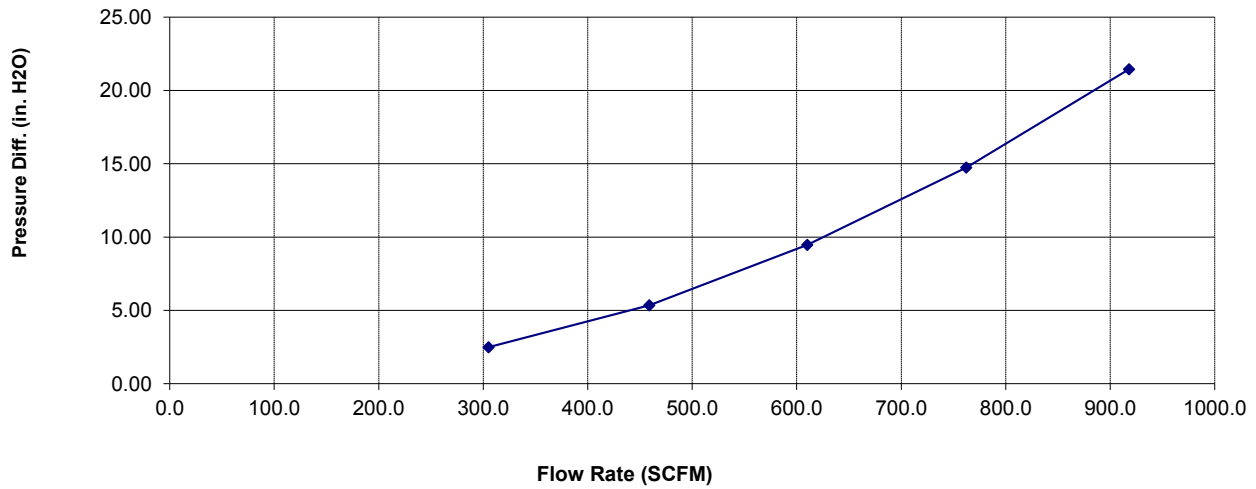

Air Flow Curve Data

<u>Flow Rate</u>	<u>Differential Pressure</u>
305	2.49
459	5.35
610	9.47
762	14.74
918	21.46



AVIS NOTICE
This equipment is loaned to you by the University of California, Davis. It is to be used only for the purpose for which it was loaned. It is not to be used for any other purpose. It is to be returned to the University of California, Davis, at the end of the loan period. It is to be returned in the same condition as it was loaned to you. It is to be returned to the University of California, Davis, at the end of the loan period. It is to be returned in the same condition as it was loaned to you. It is to be returned to the University of California, Davis, at the end of the loan period. It is to be returned in the same condition as it was loaned to you.

Chevy LML
6.6L















